




BAW56WT

RoHS
COMPLIANT

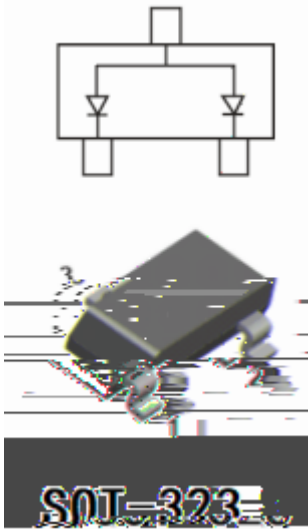

Moisture sensitivity level 1

Reverse voltage 75V

° Average forward current 150mA

Signal switching

High frequency rectifier

SOT-323

Tin plated leads, solderable per
J-STD-002 and JESD22-B102

■ (T_a=25 Unless otherwise specified)

Device marking code			KJC
Repetitive peak reverse voltage	V _{RRM}	V	100
Forward current, per leg	I _F	mA	150
Non-repetitive surge peak forward current @ t=8.3ms half-sine wave	I _{FSM}	A	2
Non-repetitive surge peak forward current @ t=1ms square wave			2
Power dissipation	P _D	mW	200
Junction temperature	T _J		-55 to +150
Storage temperature	T _{STG}		-55 to +150



BAW56WT

RoHS
COMPLIANT


Reverse voltage	V_R	V	$I_R=100\mu A$	75		
Forward voltage	V_{F1}	V	$I_F=1mA$			0.715
	V_{F2}	V	$I_F=10mA$			0.855
	V_{F3}	V	$I_F=50mA$			1
	V_{F4}	V	$I_F=150mA$			1.25
Reverse leakage current	I_R	μA	$V_R=75V$			2.5
Junction capacitance	C_j	pF	$V_R=0V, f=1MHz$			2
Reverse recovery time	T_{rr}	ns	$I_F=I_R=10mA$ $I_{rr}=0$ - 0mpac			

■ &KDUDFWHULVWL FV

)LJ 3 7 D &XUYH

&DSDFLWDQFH &DSDE\QJW\

/1μΩú1■Ω\$.úX&gCE\$0ψΩ■1ρσ/

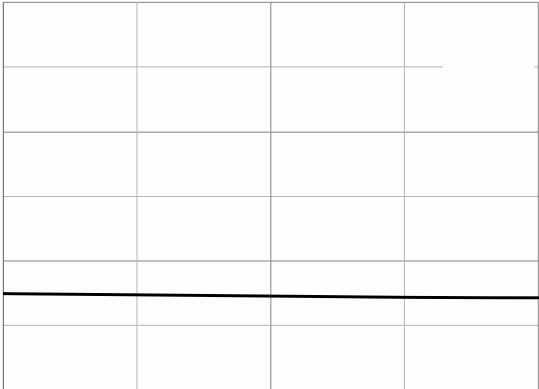

w\$Φ\$0σ\$ 3w0Pú1°\$ 3

)LJ 7\SLFDO)RUZDUG &KDUDFWHULVWL FV L5FWHUVH &KDUDFWHULVWL FV



BAW56WT

RoHS
COMPLIANT

--	--	--	--	--



BAW56WT

RoHS
COMPLIANT

The information presented in this document is for reference only. Yangzhou Yangjie Electronic Technology Co., Ltd. reserves the right to make changes without notice for the specification of the products displayed herein to improve reliability, function, or design or otherwise.

The product listed herein is designed to be used with ordinary electronic equipment or devices, and not designed to be used with equipment or devices which require high level of reliability and the malfunction of which would directly endanger human life (such as medical instruments, transportation equipment, aerospace machinery, nuclear-reactor controllers, fuel controllers and other safety devices), Yangjie or anyone on its behalf, assumes no responsibility or liability for any damages resulting from such improper use of sale.

This publication supersedes & replaces all information previously supplied. For additional information, please visit our website [http:// www.21yangjie.com](http://www.21yangjie.com) , or consult your nearest Yangjie's sales office for further assistance.